













# **Model Number**


#### RL28-8-H-2000-IR/49/74

Background suppression sensor with 4-pin, M18 x 1 plastic connector


## **Features**

- Ultra bright LEDs for power on and switching state
- Minimal black/white difference through the infrared transmission LED
- Not sensitive to ambient light, even with energy saving lamps
- Waterproof, protection degree IP67
- Protection class II

## **Dimensions**

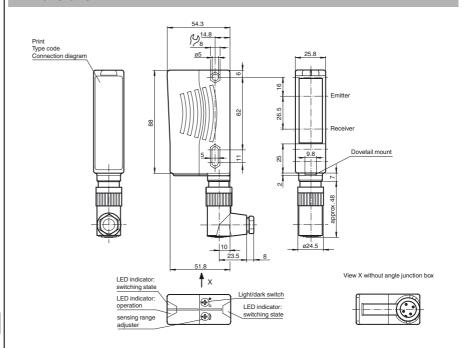


# **Electrical connection**

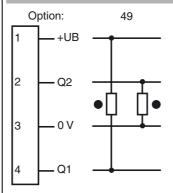

- O = Light on
- = Dark on

## **Pinout**



www.pepperl-fuchs.com

Technical data		
General specifications		
Detection range		20 2000 mm
Detection range min.		20 200 mm
Detection range max.		20 2000 mm
Background suppression		max. + 10 % of the upper limit of the detection range
Light source		IRED
Light type		modulated infrared light, 880 nm
Black/White difference (6 %/90 %)	)	< 40 %
Diameter of the light spot		approx. 70 mm at a distance of 2000 mm
Angle of divergence		transmitter 2°
		receiver 2°
Ambient light limit		50000 Lux
Functional safety related parame	ters	
MTTF <sub>d</sub>		1130 a
Mission Time (T <sub>M</sub> )		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operating display		LED green
Function display		2 LEDs yellow
		ON: object inside the scanning range OFF: object outside the scanning range
Controls		Light/Dark switch
Controls		Detection range adjuster
Electrical specifications		20toston rango adjuston
Operating voltage	$U_{B}$	10 30 V DC
Ripple	ОВ	10 %
No-load supply current	I <sub>O</sub>	≤ 40 mA
Output	-0	
Switching type		light/dark on switchable
Signal output		1 NPN, 1 PNP synchronized-switching, short-circuit protected,
		reverse polarity protected
Switching voltage		max. 30 V DC
Switching current		max. 200 mA
Switching frequency	f	250 Hz
Response time		2 ms
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 75 °C (-40 167 °F)
Mechanical specifications		
Protection degree		IP67
Connection		connector M18, 4-pin
Material		
Housing		Plastic ABS
Optical face		plastic
Connector		plastic
Mass		70 g
Compliance with standards and oves	directi-	
Standard conformity		
Product standard		EN 60947-5-2:2007
Approvals and certificates		
Protection class		II, rated voltage ≤ 250 V AC with pollution degree 1-2 according to IEC 60664.1
III approval		ding to IEC 60664-1
UL approval		CULus
CCC approval		Products with a maximum operating voltage of ≤36 V do not bear a CCC marking because they do not require approval.

## **Accessories**

## **OMH-05**

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

### **OMH-21**

Mounting bracket

#### **OMH-22**

Mounting bracket

# OMH-MLV11-K

dove tail mounting clamp

#### **OMH-RLK29**

Mounting bracket

#### OMH-RLK29-HW


Mounting bracket for rear wall mounting


#### OMH-RL28-C

Protective cover

Other suitable accessories can be found at www.pepperl-fuchs.com

## **Curves/Diagrams**

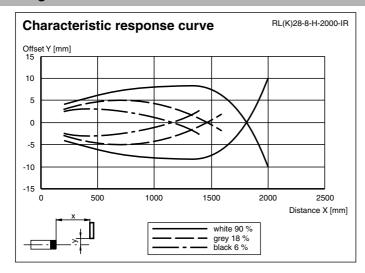

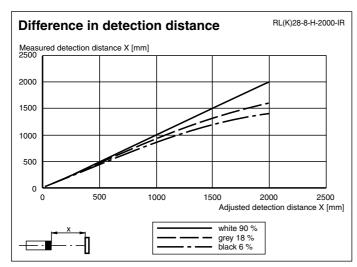

## Additional information

#### Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

## **Mounting instructions:**

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

### Adjustment:

After the operating voltage is applied, the LED is lit green.

fa-info@us.pepperl-fuchs.com

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

# **Object direction:**

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

## Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.

420983\_eng.xml