











# **Model Number**


# RL28-8-H-400-IR/49/115

Background suppression sensor with 2.5 m fixed cable


# **Features**

- Ultra bright LEDs for power on and switching state
- Minimal black/white difference through the infrared transmission LED
- Not sensitive to ambient light, even with energy saving lamps
- Waterproof, protection degree IP67
- Protection class II

# **Dimensions**

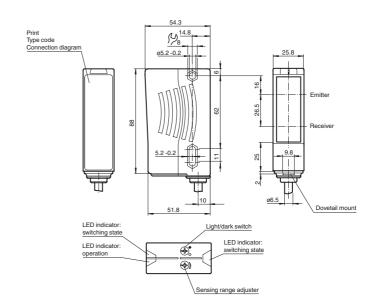

# **Electrical connection**

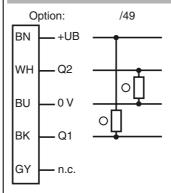

- O = Light on
- = Dark on

fa-info@us.pepperl-fuchs.com

www.pepperl-fuchs.com

Technical data					
General specifications					
Detection range		20 400 mm			
Detection range min.		20 150 mm			
Detection range max. Light source Light type Black/White difference (6 %/90 %) Diameter of the light spot		20 400 mm IRED modulated infrared light , 880 nm < 5 % approx. 14 mm at a distance of 400 mm			
			Angle of divergence		transmitter 2° receiver 2°
			Ambient light limit		50000 Lux
			Functional safety related para	ameters	
			MTTF <sub>d</sub>		1130 a
Mission Time (T <sub>M</sub> )		20 a			
Diagnostic Coverage (DC)		0 %			
Indicators/operating means					
Operating display		LED green			
Function display		2 LEDs yellow ON: object inside the scanning range OFF: object outside the scanning range			
Controls		Light/Dark switch			
Controls		Detection range adjuster			
Electrical specifications					
Operating voltage	$U_B$	10 30 V DC			
Ripple		10 %			
No-load supply current	I <sub>0</sub>	≤ 40 mA			
Output					
Switching type		light/dark on switchable			
Signal output		NPN, 1 PNP synchronized-switching, short-circuit protected reverse polarity protected , open collectors			
Switching voltage		max. 30 V DC			
Switching current		max. 200 mA			
Switching frequency	f	250 Hz			
Response time		2 ms			
Ambient conditions					
Ambient temperature		-40 60 °C (-40 140 °F)			
Storage temperature		-40 75 °C (-40 167 °F)			
Mechanical specifications					
Protection degree		IP67			
Connection		2500 mm fixed cable			
Material					
Housing		Plastic ABS			
Optical face		plastic			
Mass		70 g			
Compliance with standards at ves	nd direct	j-			
Standard conformity					
Product standard		EN 60947-5-2:2007			
Approvals and certificates					
Protection class		II, rated voltage ≤ 250 V AC with pollution degree 1-2 according to IEC 60664-1			
UL approval		cULus			
CCC approval		Products with a maximum operating voltage of ≤36 V do not bear a CCC marking because they do not require approval			

# **Accessories**

# **OMH-05**

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

## **OMH-21**

Mounting bracket

## **OMH-22**

Mounting bracket

# OMH-MLV11-K

dove tail mounting clamp

## **OMH-RLK29**

Mounting bracket


# OMH-RLK29-HW

Mounting bracket for rear wall mounting

#### OMH-RL28-C

Protective cover

Other suitable accessories can be found at www.pepperl-fuchs.com

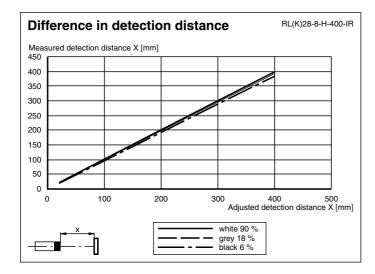

# **Additional information**

#### Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

# **Mounting instructions:**

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

## Adjustment:

After the operating voltage is applied, the LED is lit green.

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

# Object direction:

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

## Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.

421220 eng.xml